


404, DSP, DSH

Carrier Mounting Flange Design Change


Axle Housing Fasteners

On June 3, 2002 the DSP40(P), DSP 41(P), DDP40(P), DDP41(P), RSP40, RSP41, RDP40 and RDP41 models were upgraded to the new "Thick Flange" carrier design as fully detailed in Dana bulletin AXIP-0210R1. Shown below are the axle housing hardware kits and fastener locations for both variations. View fastener locations as if installing differential into the axle housing.

Thick Flange - After 6/3/02

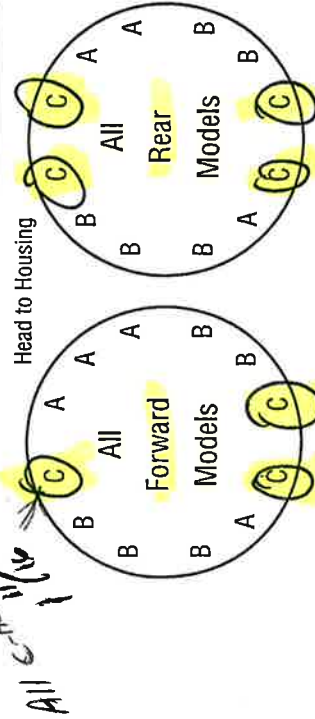

Original Design Flange - Before 6/3/02*

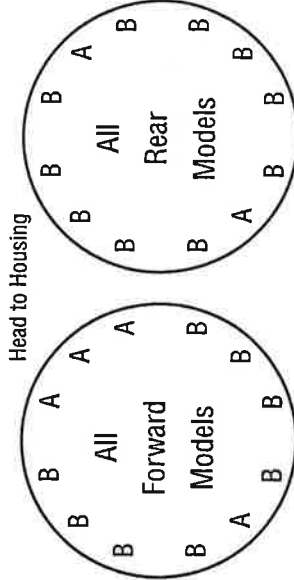

Note: GM models require a special double-ended capscrews. They continue to use carriers with the original design thin flange. At this time Dana does not have a double-ended capscrew for "Thick Flange" models.

- A - 127641 Studs & 127567 Nuts
- B - 130836 Capscrews - Short (45 mm)
- C - 130837 Capscrews - Long (70 mm)
- D - 130877 Flat Washers - All Locations

512087 Hardware Kit (Thick Flange)

Part No.	Qty.	Description
107276S	1	RTV Sealant 3 oz. Tube
127567	4	Nut